



SERVICE MANUAL

MODEL
TC1966D

REVISION
SUFFIX C

COLOR TELEVISION RECEIVER

AKB AUTOMATIC KINE BIAS



SUFFIX	PRODUCT IMPROVEMENT			TRANSISTOR
A	ORIGINAL			2SC4159(D,E)
B	CHANNEL AUTO MEMORY IMPROVEMENT	EARPHONE JACK DELETED	FOR VA	2SC3902(S,I)
C			FOR VA	2SC4159(D,E)

Please file this suffix with the original version (Suffix A).

SERVICE PUBLICATION

#60-92

DIFFERENCES

For VA (Jack Plate deletion)

REF. NO	DESCRIPTION	SUFFIX B	SUFFIX C
		PART NO	
106	CABINET, BACK	702APAO043	702APAO049
107	PLATE, JACK	771TPAO018	DEL

MAIN PCB ASSEMBLIES

PCB001	
SUFFIX	Part No.
A	A39709A01A
B	A39709A01BZ1 ☆
C	A39709A01CZ1 ☆

☆: MAIN PCB's are interchangeable.

DIFFERENCES

For interchangeability (TRANSISTOR)


REF. NO	SUFFIX B		SUFFIX A, C	
	PART NO	DESCRIPTION	PART NO	DESCRIPTION
△Q351	TC30039020	TRANSISTOR 2SC3902(S, I)	TC30041590	TRANSISTOR 2SC4159(D, E)
△Q352	TC30039020	TRANSISTOR 2SC3902(S, I)	TC30041590	TRANSISTOR 2SC4159(D, E)
PCB001	A39709A01BZ1	MAIN PCB ASS'Y	SEE ABOVE	MAIN PCB ASS'Y

MECHANICAL REPLACEMENT PARTS LIST

REF. NO	DESCRIPTION	SUFFIX A, B	SUFFIX C
		PART NO	
112	ANGLE, FBT	761TSA0158	761SSA0007
---	GIFT, BOX	793ACD0243	793ACD0257

MECHANICAL EXPLODED VIEW

(SUFFIX A, B)

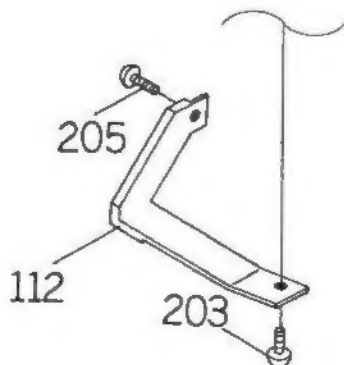

(SUFFIX C)

